



Technical Service BULLETIN

March 1, 2006

Title:

EXCESSIVE SULFUR ODOR

Models:

'06 Tacoma (1GR-FE)

TSB

ENGINE
EG014-06

Introduction Some customers may complain of excessive sulfur odor on 2006 model year Tacoma vehicles equipped with the 1GR-FE (V6) engine under the following conditions:

- Stop and go driving
- Heavy acceleration

In order to reduce the sulfur odor, new catalytic converter assemblies have been made available. Follow the repair procedure to replace the catalytic converter assemblies.

NOTE:

For more complete understanding of the root cause, refer to TSB No. EG003-03, "Sulfur Odor from Exhaust."

Applicable Vehicles

- 2006 model year Tacoma vehicles equipped with the 1GR-FE (V6) engine.

Parts Information

ORIGINAL PART NUMBER*	REPAIR PART NUMBER*	PART NAME	QTY
17410-0P020	17410-0P140	Pipe Assembly, Exhaust, Front (RH)	1
17450-0P020	17450-0P090	Pipe Assembly, Exhaust, Front, No. 2 (LH 2WD)	1
17450-0P030	17450-0P100	Pipe Assembly, Exhaust, Front, No. 2 (LH 4WD)	1

*** NOTE:**

The original part numbers (17410-0P020, 17450-0P020, and 17450-0P030) are currently used in vehicle production and are still available as service parts. The repair part numbers (17410-0P140, 17450-0P090, and 17450-0P100) should only be used when the customer complains of sulfur odor.

Repair Procedure

Refer to the Technical Information System (TIS): 2006 model year Tacoma Repair Manual: *Exhaust: Exhaust Pipe Assy (1GR-FE)*.

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
170171	R & R Front Exhaust Pipe Assemblies	0.4	17410-0P020 17450-0P020 (2WD) 17450-0P030 (4WD)	60	99

Applicable Warranty:**

This repair is covered under the Toyota Specified Major Emission Control Component Warranty. This warranty is in effect for 96 months or 80,000 miles, whichever occurs first, from the vehicle's in-service date.

** Warranty application is limited to correction of a problem based upon a customer's specific complaint.

